

## PIC16(L)F18854 Family Silicon Errata and Data Sheet Clarification

The PIC16(L)F18854 family devices that you have received conform functionally to the current Device Data Sheet (DS40001826A), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).


The errata described in this document will be addressed in future revisions of the PIC16(L)F18854 silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**A1**).

Data Sheet clarifications and corrections start on [page 4](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers, and emulation tools, which are available at the Microchip corporate website ([www.microchip.com](http://www.microchip.com)).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

1. Using the appropriate interface, connect the device to the hardware debugger.
2. Open an MPLAB IDE project.
3. Configure the MPLAB IDE project for the appropriate device and hardware debugger.
4. Based on the version of MPLAB IDE you are using, do one of the following:
  - a) For MPLAB IDE 8, select *Programmer > Reconnect*.
  - b) For MPLAB X IDE, select *Window > Dashboard* and click the **Refresh Debug Tool Status** icon (  ).
5. Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC16(L)F18854 silicon revisions are shown in [Table 1](#).

**TABLE 1: SILICON DEVREV VALUES**

Part Number	Device ID <sup>(1)</sup>	Revision ID (Silicon Revision) <sup>(2)</sup>
		A1
PIC16F18854	306Ah	2001h
PIC16LF18854	306Bh	2001h

- Note 1:** The Revision ID and Device ID are located in the Configuration memory at addresses 8005h and 8006h, respectively.
- 2:** Refer to the “*PIC16(L)F188XX Memory Programming Specification*” (DS40001753) for detailed information on Device and Revision IDs for your specific device.

# PIC16(L)F18854

**TABLE 2: SILICON ISSUE SUMMARY**

Module	Feature	Item No.	Issue Summary	Affected Revision <sup>(1)</sup>
				A1
Analog-to-Digital Converter with Computation (ADC2)	Computation Overflow Bit	1.1	The Computation Overflow bit will be erroneously set by the ADFLTR.	X
Analog-to-Digital Converter with Computation (ADC2)	ADC Conversion	1.2	When using ADCRC as the ADCC clock source there is a delay of one instruction cycle to set the ADGO bit.	X
NVMREG Access	NVMREG Access	2.1	Self-writes on LF devices below 2.2V at -40°C may not work.	X
EEPROM	Indirect Read	3.1	Indirect read of EEPROM with FSR returns unexpected value.	X
ECCP	Compare Mode	4.1	Toggle mode may output multiple pulses when source clock has a prescaler other than 1:1.	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

## Silicon Errata Issues

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (A1).

### 1. Module: Analog-to-Digital Converter with Computation (ADC2)

#### 1.1 Computation Overflow Bit

If the sign bit of ADFLTR (bit 7 of ADFLTRH) is set, the Computation Overflow bit will also be set, even though this is not a legitimate case of an overflow event.

##### Work around

None.

##### Affected Silicon Revisions

A1								
X								

#### 1.2 ADC Conversion

When using ADCRC as the clock source for ADCC, there is a delay of one instruction cycle between the user setting the ADGO bit and being able to read it set. This can lead to a false conversion complete scenario (i.e., ADGO being cleared), depending if the user code has a bit clear test (BTFSC) instruction on the ADGO bit, immediately after setting the ADGO bit. See code example below.

e.g.

```
BSF ADCON0, ADGO ; Start conversion
BTFSC ADCON0, ADGO ; Is conversion done?
GOTO $-1 ; No, test again
```

The BTFSC will pass the very first time in this situation

##### Work around

Add a NOP instruction after setting the ADGO bit and before testing the bit for completion of conversion. See code example below.

e.g.

```
BSF ADCON0, ADGO ; Start conversion
NOP
BTFSC ADCON0, ADGO ; Is conversion done?
GOTO $-1; ; No, test again
```

##### Affected Silicon Revisions

A1								
X								

### 2. Module: Nonvolatile Memory Control

#### 2.1 NVMREG Access

When performing self-writes through NVMREG access on PIC16LF18854 devices with VDD below 2.2V and temperature of -40°C, the writes may not work. This applies to both PFM and EEPROM writes.

##### Work around

None.

##### Affected Silicon Revisions

A1								
X								

### 3. Module: EEPROM

#### 3.1 Indirect Read

Performing FSR reads of Data EEPROM addresses other than the lowest address (FSR=7000h) will return unexpected values.

##### Work around

Set NVMADRH:L to the desired address (F000h through F0FFh) and retrieve the EEPROM value from the NVMDATL register by setting the NVMREGS and RD bits in the NVMCON1 register.

##### Affected Silicon Revisions

A1								
X								

### 4. Module: ECCP

#### 4.1 Compare Mode

The ECCP Compare Toggle modes (CCPxCON<3:0> bits = 0010 or 0001) output multiple pulses instead of a single toggle pulse when its source clock has a prescaler other than 1:1.

##### Work around

Use CCP Compare mode with pulse output (CCPxCON<3:0> bits = 1011) to clock a CLC configured as a J-K flip-flop in Toggle mode.

##### Affected Silicon Revisions

A1								
X								

# PIC16(L)F18854

## Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS40001826A):

**Note:** Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

## 1. Module: Analog-to-Digital Converter with Computation (ADC<sup>2</sup>)

In [Register 23-3](#): ADCON2, bit 7: ADPSIS has incorrect descriptions for its bit selections. The correct description is below:

### REGISTER 23-3: ADCON2: ADC CONTROL REGISTER 2

R/W-0/0	R/W-0/0	R/W-0/0	R/W-0/0	R/W/HC-0	R/W-0/0	R/W-0/0	R/W-0/0
ADPSIS	ADCRS<2:0> <sup>(2)</sup>			ADACL	ADMD<2:0> <sup>(1)</sup>		
bit 7				bit 0			

#### Legend:

R = Readable bit	W = Writable bit	U = Unimplemented bit, read as '0'
u = Bit is unchanged	x = Bit is unknown	-n/n = Value at POR and BOR/Value at all other Resets
'1' = Bit is set	'0' = Bit is cleared	

- bit 7      **ADPSIS: ADC Previous Sample Input Select bits**  
 1 = **ADFLTR is transferred to ADPREV at start-of-conversion**  
 0 = **ADRES is transferred to ADPREV at start-of-conversion**
- bit 6-4      ADCRS<2:0>: ADC Accumulated Calculation Right Shift Select bits  
 111 = Reserved  
 110 = Reserved  
 101 through 000:  
If ADMD = 100:  
 Low-pass filter time constant is  $2^{\text{ADCRS}}$ , filter gain is 1:1  
If ADMD = 001, 010 or 011:  
 The accumulated value is right-shifted by ADCRS (divided by  $2^{\text{ADCRS}}$ )<sup>(2)</sup>  
Otherwise:  
 Bits are ignored
- bit 3      ADACL: ADC Accumulator Clear Command bit  
 1 = Initial clear of ADACC, ADAOV, and the sample counter. Bit is cleared by hardware.  
 0 = Clearing action is complete (or not started)
- bit 2-0      ADMD<2:0>: ADC Operating Mode Selection bits<sup>(1)</sup>  
 111 = Reserved  
 •  
 •  
 •  
 101 = Reserved  
 100 = Low-pass Filter mode  
 011 = Burst Average mode  
 010 = Average mode  
 001 = Accumulate mode  
 000 = Basic (Legacy) mode

**Note 1:** See [Table 23-3](#) for Full-mode descriptions.

**2:** All results of divisions using the ADCRS bits are truncated, not rounded.

## 2. Module: Complementary Waveform Generator (CWG)

In [Register 20-9](#): CWGxISM, IS<3:0> has incorrect descriptions for its bit selections. The correct description is below:

bit 7-4 **Unimplemented**: Read as '0'

bit 3-0 **IS<3:0>**: CWGx Input Selection bits

1111 = LC4\_out

1110 = LC3\_out

1101 = LC2\_out

1100 = LC1\_out

1011 = DSM\_out

1010 = C2OUT\_sync

1001 = C1OUT\_sync

1000 = NCO1\_out

0111 = PWM7\_out

0110 = PWM6\_out

0101 = CCP5\_out

0100 = CCP4\_out

0011 = CCP3\_out

0010 = CCP2\_out

0001 = CCP1\_out

0000 = CWGxIN PPS

## 3. Module: Signal Measurement Timer (SMT)

The description for the Counter mode of the SMT given in 32.6.9 contains incorrect information, given the setup described earlier in the chapter. The corrected text is as follows:


This mode increments the timer on each pulse of the SMTx\_signal input. This mode is asynchronous to the SMT clock and uses the SMTx\_signal as a time source. The SMTxCPW register will be updated with the current SMTxTMR value on the **falling** edge of the SMTxWIN input.

# PIC16(L)F18854


## 4. Module: Signal Measurement Timer (SMT)

Several timing diagrams in the Signal Measurement Timer chapter (namely Figures 32-14, 32-15, and 32-18) contain inaccuracies. The correct versions of these timing diagrams are below.


**FIGURE 32-14: TIME OF FLIGHT MODE REPEAT ACQUISITION TIMING DIAGRAM**

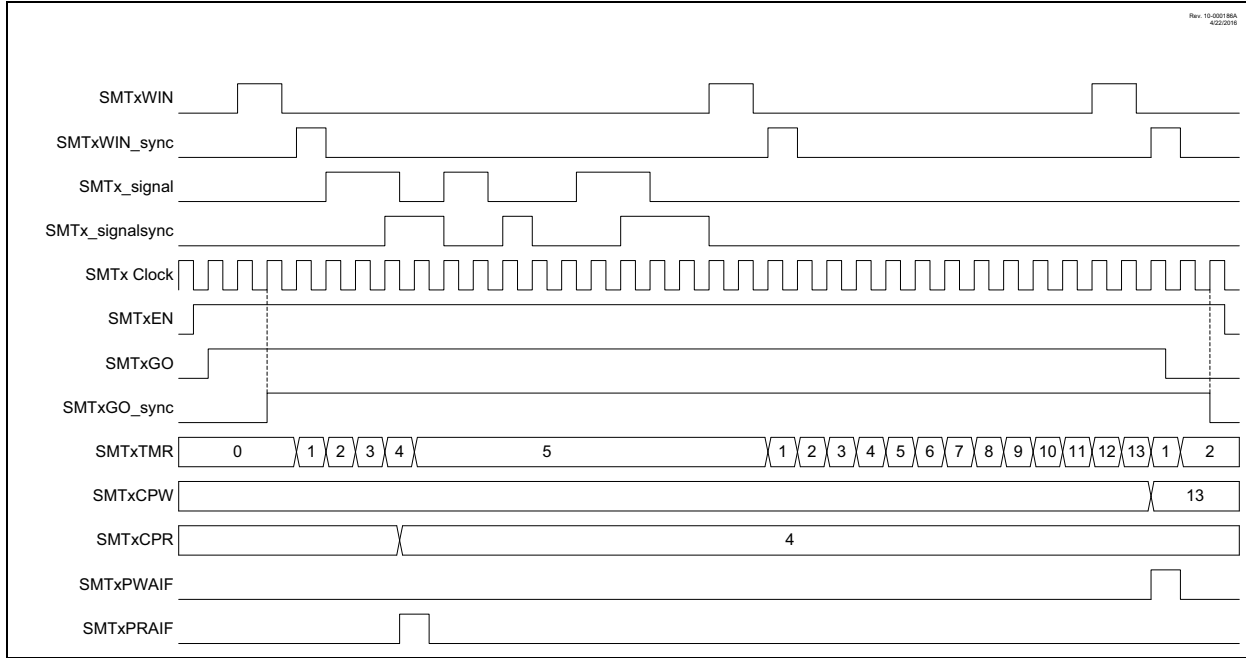

**FIGURE 32-15: TIME OF FLIGHT MODE SINGLE ACQUISITION TIMING DIAGRAM**

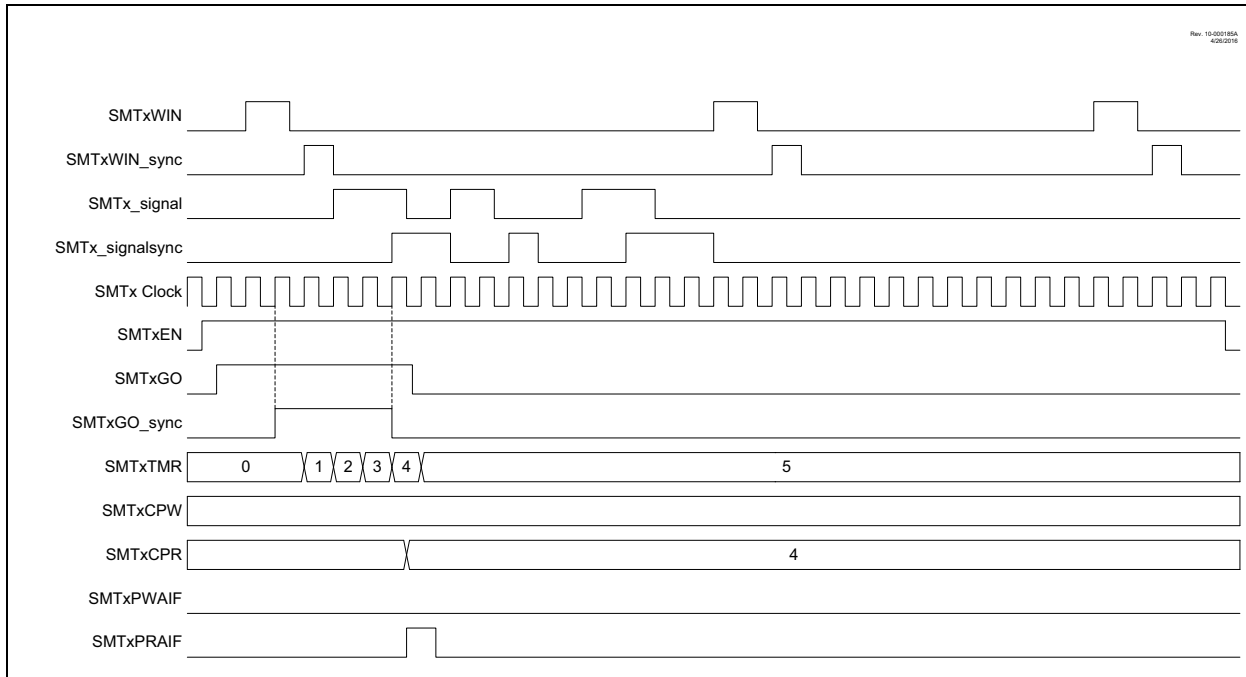


**FIGURE 32-18: COUNTER MODE TIMING DIAGRAM**

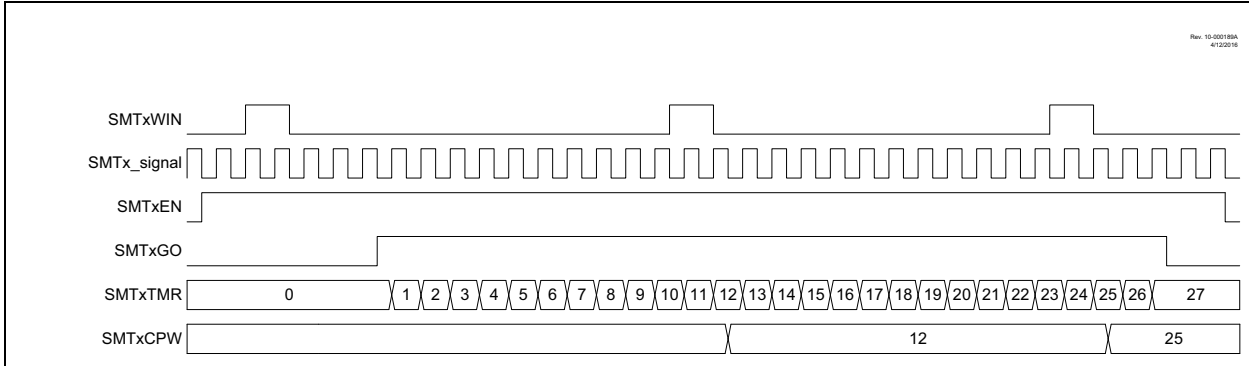

## 5. Module: Timer2/4/6


Several timing diagrams in the Timer2/4/6 chapter (namely [Figure 29-3](#), as well as [Figures 29-8](#) through [29-13](#)) contain inaccuracies. The correct timing diagrams are shown below.

**FIGURE 29-3: TIMER2 PRESCALER POSTSCALER, AND INTERRUPT TIMING DIAGRAM**

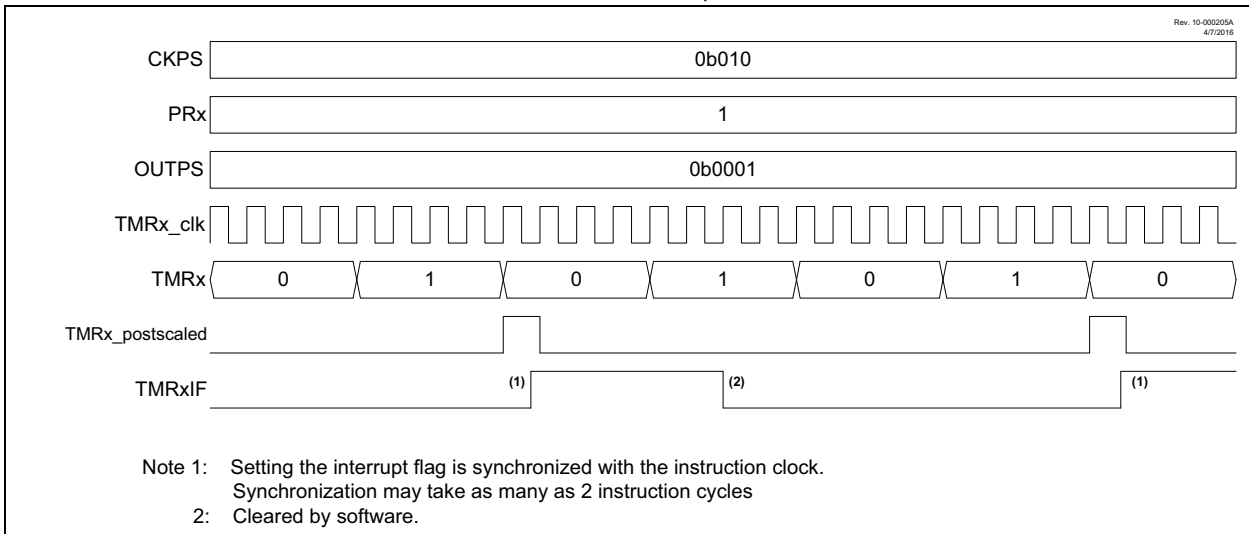


# PIC16(L)F18854

**FIGURE 29-8: SOFTWARE START ONE-SHOT MODE TIMING DIAGRAM (MODE = 01000)**

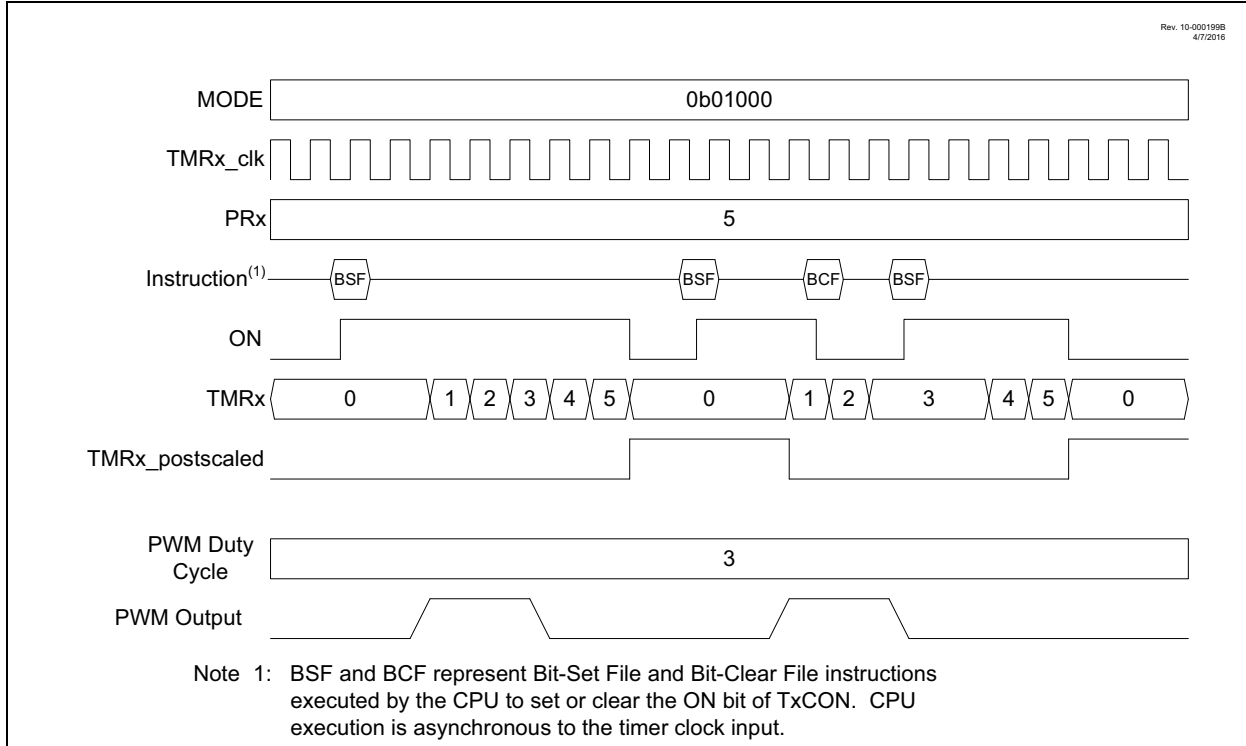


**FIGURE 29-9: EDGE-TRIGGERED ONE-SHOT MODE TIMING DIAGRAM (MODE = 01001)**

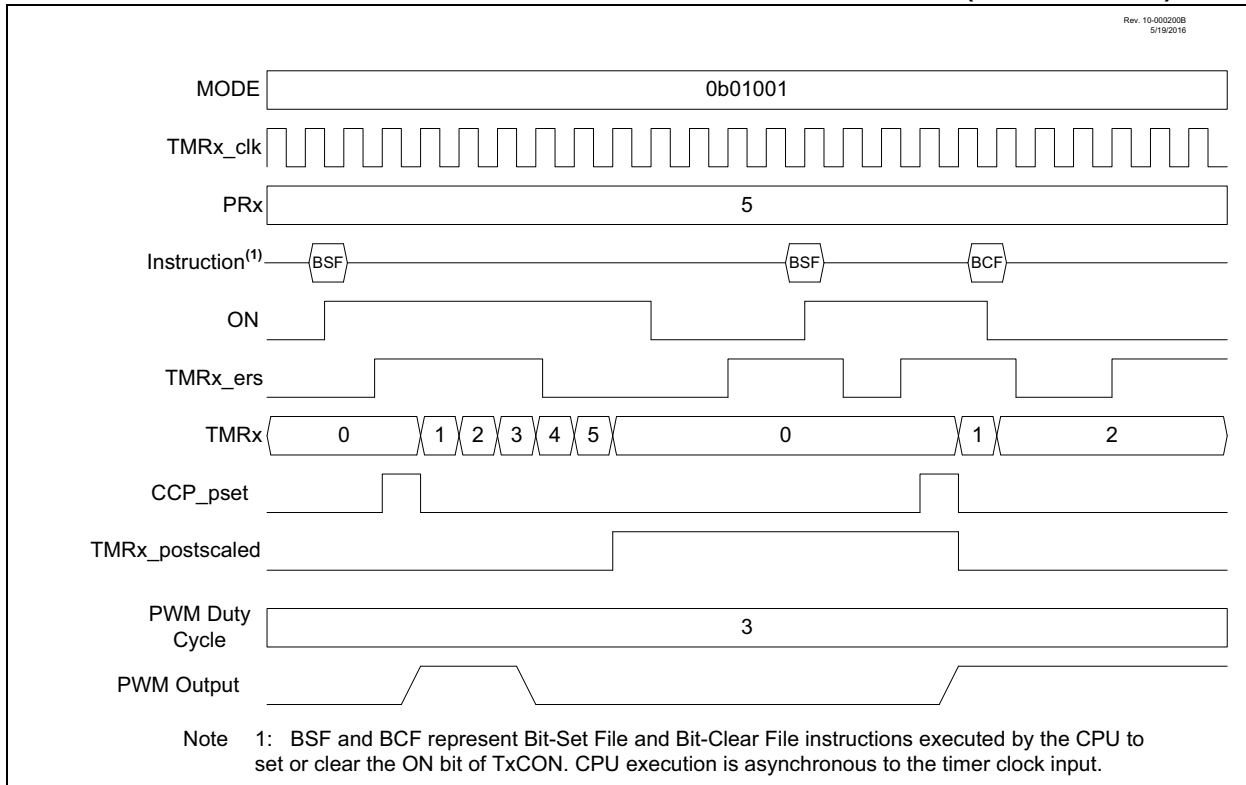




**FIGURE 29-10: EDGE-TRIGGERED HARDWARE LIMIT ONE-SHOT MODE TIMING DIAGRAM (MODE = 01100)**

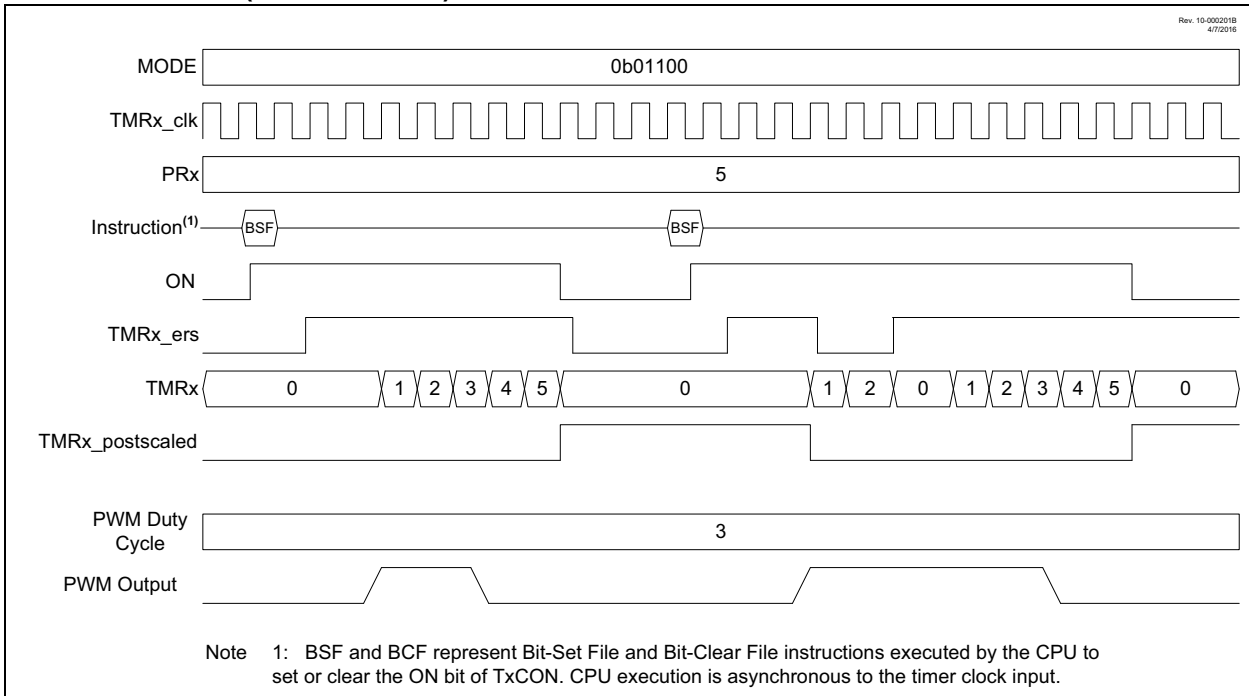


**FIGURE 29-11: LOW LEVEL RESET, EDGE-TRIGGERED HARDWARE LIMIT ONE-SHOT MODE TIMING DIAGRAM (MODE = 01110)**

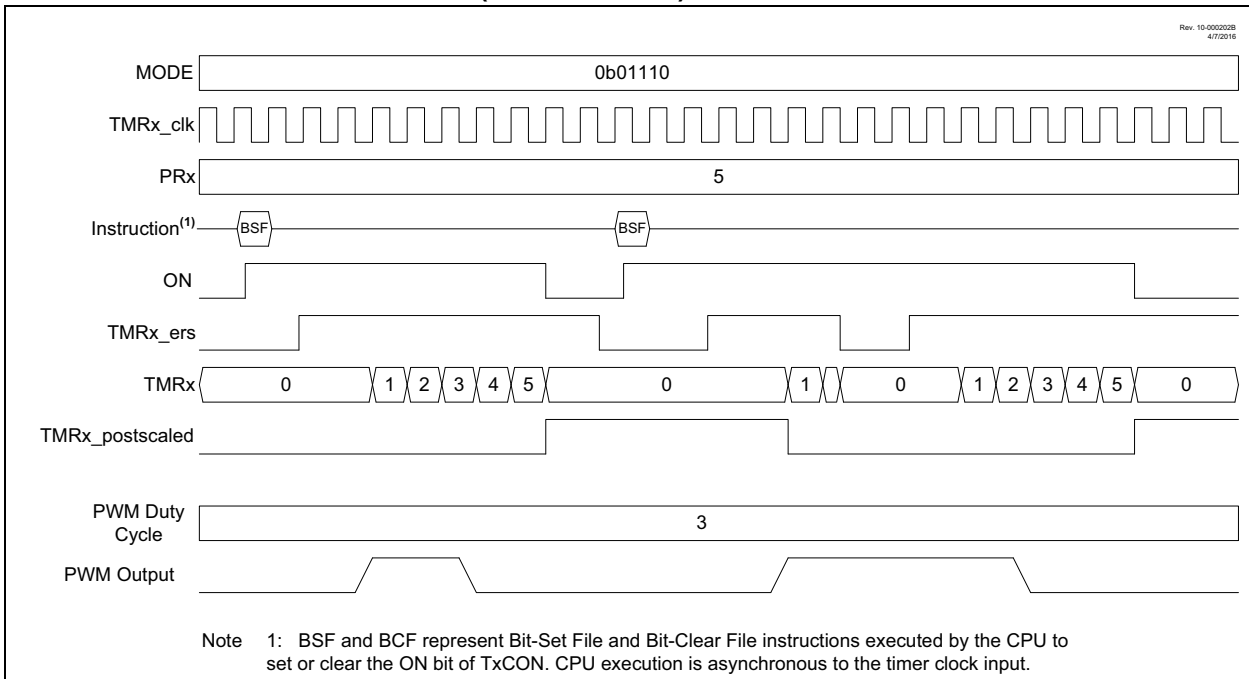


# PIC16(L)F18854

**FIGURE 29-12: RISING EDGE-TRIGGERED MONOSTABLE MODE TIMING DIAGRAM (MODE = 10001)**

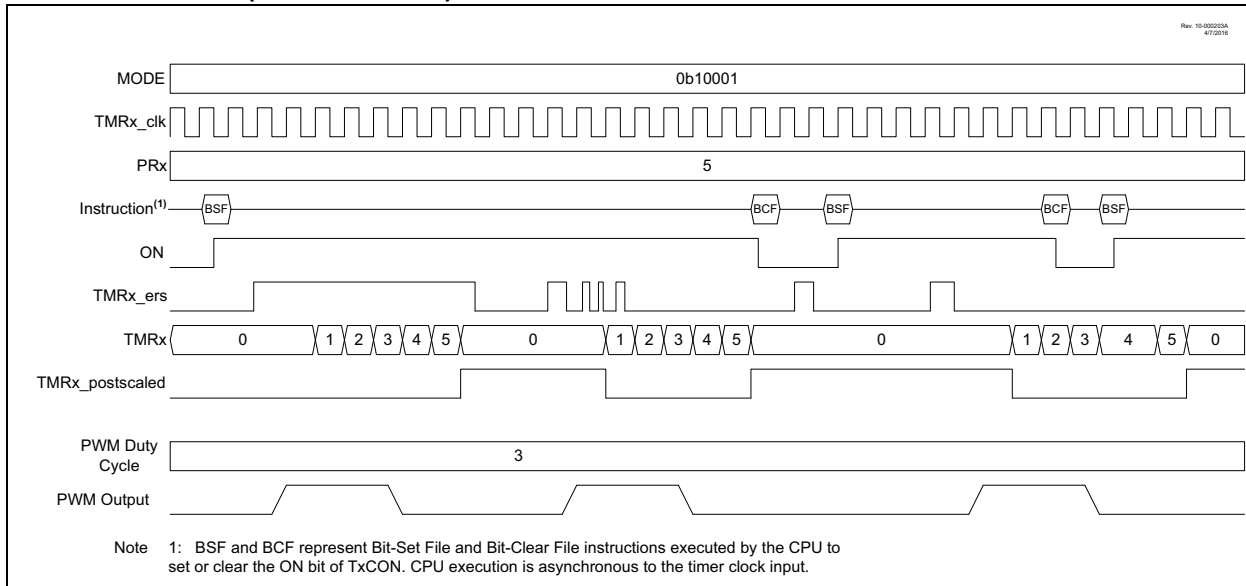

**FIGURE 29-13: LEVEL-TRIGGERED HARDWARE LIMIT ONE-SHOT MODE TIMING DIAGRAM (MODE = 10110)**

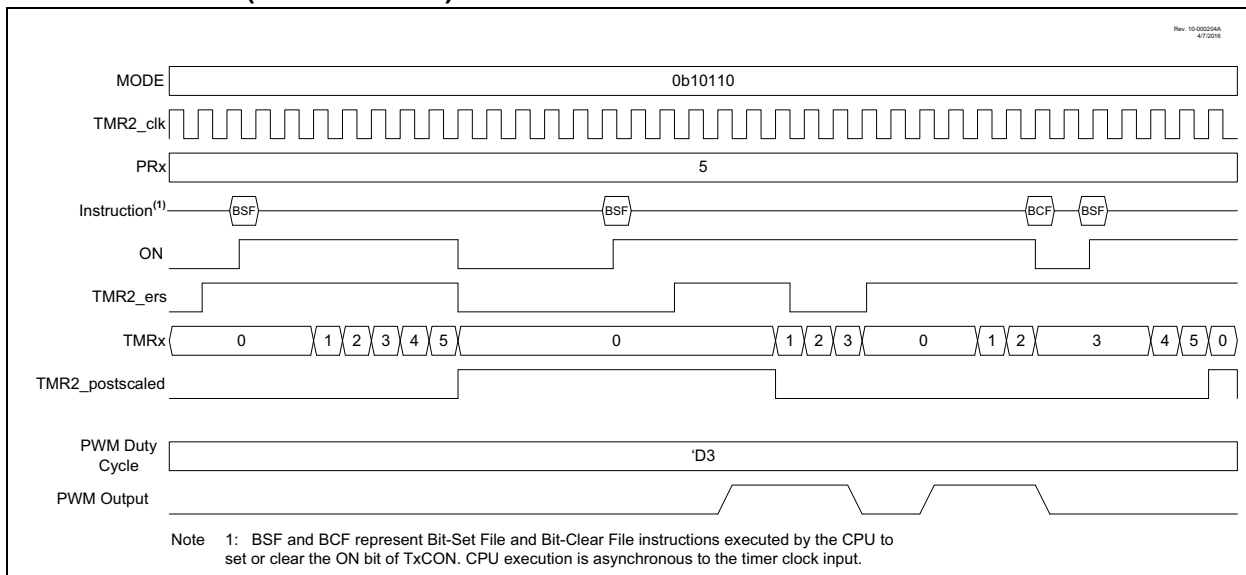

## 6. Module: Nonvolatile Memory (NVM) Control

Tables 10-2 and 10-3 contain several inaccuracies and should be as follows:

**TABLE 10-2: NVM ORGANIZATION AND ACCESS INFORMATION**

Master Values			NVMREG Access			FSR Access	
Memory Function	Program Counter (PC), ICSP™ Address	Memory Type	NVMREGS bit (NVMCON1)	NVMADR <14:0>	Allowed Operations	FSR Address	FSR Programming Address
Reset Vector	0000h	PFM	0	0000h	Read Write	8000h	Read-Only
User Memory	0001h		0	0001h		8001h	
	0003h			0003h		8003h	
INT Vector	0004h		0	0004h		8004h	
User Memory	0005h		0	0005h		8005h	
	07FFh			07FFh		FFFFh	
User ID	8000h	PFM	1	0000h	Read Write	No Access	
	8003h			0003h			
Reserved	8004h	—	—	0004h	—		
Rev ID	8005h	PFM	1	0005h	Read-Only		
Device ID	8006h		1	0006h			
CONFIG1	8007h		1	0007h	Read Write		
CONFIG2	8008h		1	0008h			
CONFIG3	8009h		1	0009h			
CONFIG4	800Ah		1	000Ah			
CONFIG5	800Bh	1	000Bh	Read Write			
User Memory	F000h	EEPROM	1	F000h	Read Write	7000h	Read-Only
	F0FFh			F0FFh		70FFh	

## 7. Module: Analog-to-Digital Converter with Computation (ADC<sup>2</sup>)

Section 23.5.2 “Basic Mode” is inconsistent with Table 23-3 and contains inaccuracies. The correct text of this section should read:

Basic mode (ADMD = 000) disables all additional computation features. In this mode, no accumulation occurs. Double sampling, Continuous mode, all CVD features, **and threshold error detection** are still available, but no features involving the digital filter/average features are used.

## 8. Module: Analog-to-Digital Converter with Computation (ADC<sup>2</sup>)

Section 23.5.3 “Accumulate Mode” is inconsistent with Table 23-3 and contains inaccuracies. The correct text of this section should read:


In Accumulate mode (ADMD = 001), the ADC conversion result is **added to the ADACC registers**. The Formatting mode does not affect the right-justification of the ADACC value. Upon each sample, ADCNT is incremented, indicating the number of samples accumulated. After each sample and accumulation, **the ADFLTR register is updated with the value of ADACC right shifted by the ADCRS value, a threshold comparison is performed** (see Section 23.5.7 “Threshold Comparison”), and the ADTIF interrupt may trigger.



## 11. Module: Timer1

Figure 28-1 is incorrect. The correct diagram is below:

**FIGURE 28-1: TIMER1**

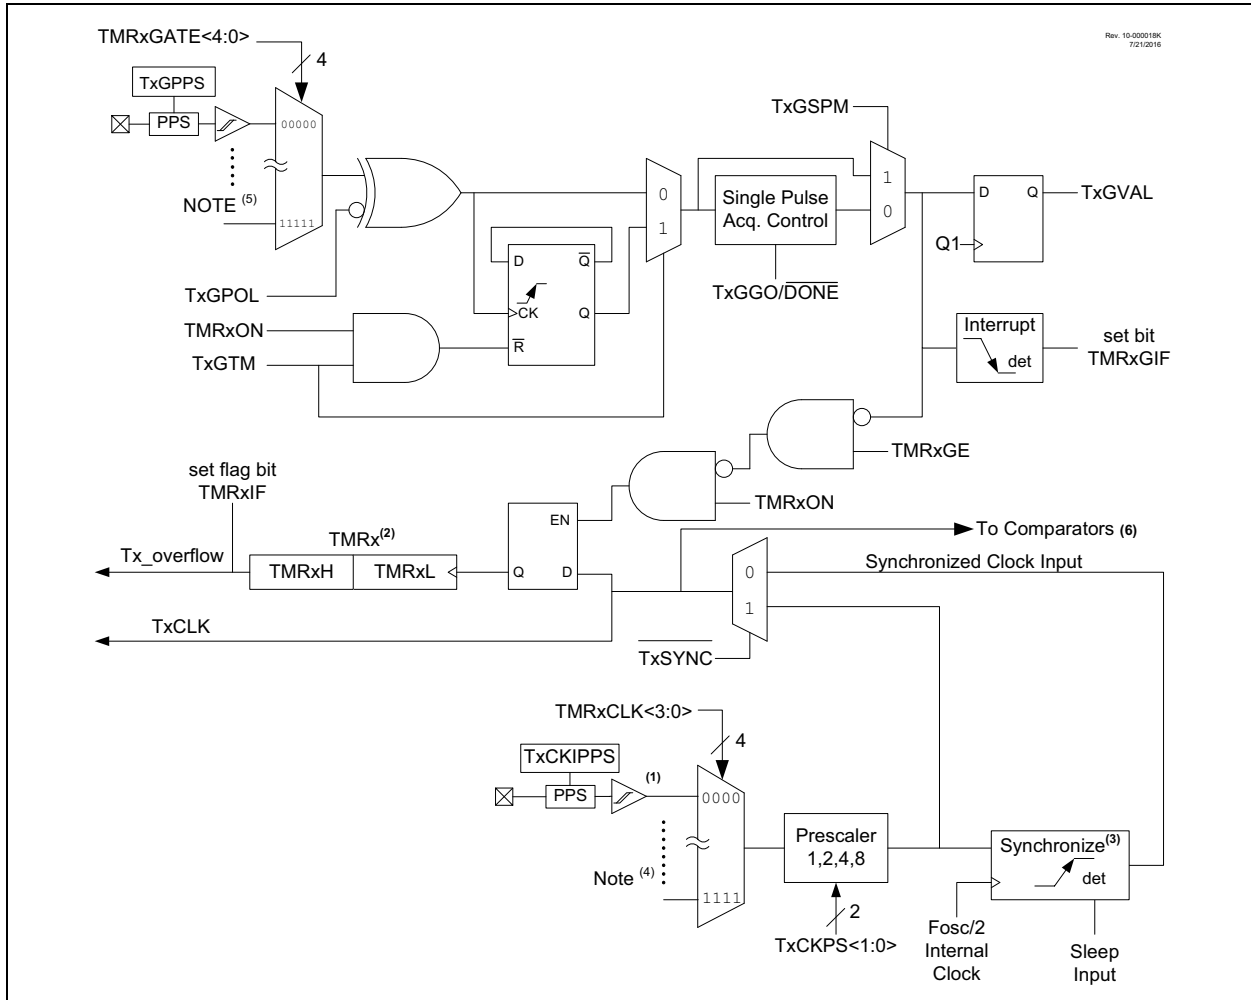

## 12. Module: Timer1

Bit RD16 of TXCON: Timer1/3/5 Control Register has an incorrect bit description. The correct description is below:

bit1 RD16: Timer1 16-Bit Read Enable


- 1 = All 16 bits of Timer1 can be read simultaneously (TMR1H is buffered)
- 0 = 16-bit reads of Timer1 are disabled (TMR1H not buffered)

# PIC16(L)F18854

## 13. Module: Analog-to-Digital Converter with Computation (ADC<sup>2</sup>)

Figure 23-2: Analog-to-Digital Converter with Computation (ADC<sup>2</sup>) is inaccurately described in the data sheet for the ADCC. It should be as follows:

FIGURE 23-2: ANALOG-TO-DIGITAL CONVERTER WITH COMPUTATION (ADC<sup>2</sup>)

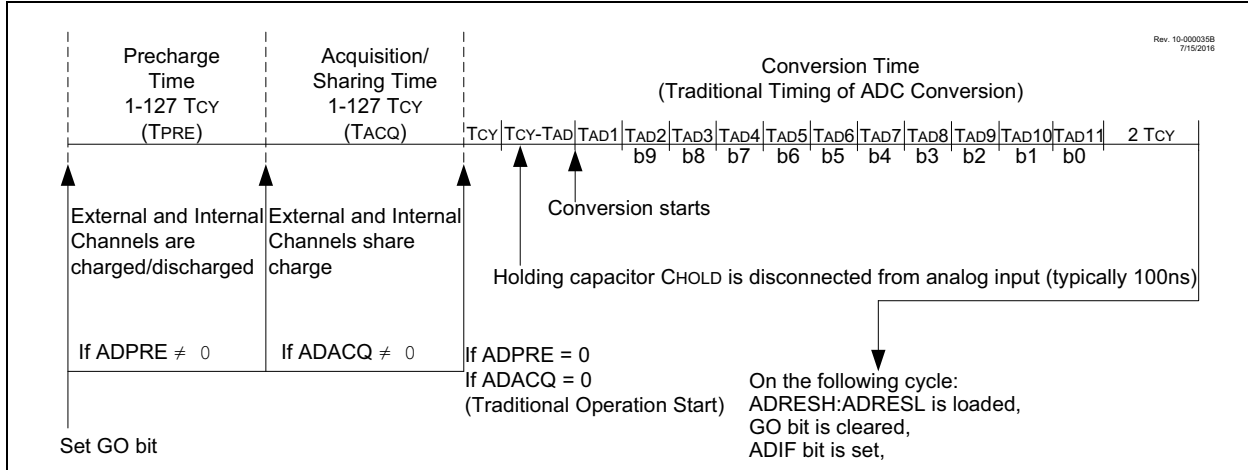

## 14. Module: Electrical Specifications

The typical value for specification D207 in TABLE 37-3: POWER-DOWN CURRENT (IPD) (IPD) is incorrect. The correct value is 28, as shown below in bold.

TABLE 37-3: TABLE 37-3: POWER-DOWN CURRENT (IPD)

PIC16LF18856/76		Standard Operating Conditions (unless otherwise stated)							
PIC16F18856/76		Standard Operating Conditions (unless otherwise stated) VREGPM = 1							
Param. No.	Symbol	Device Characteristics	Min.	Typ.†	Max. +85°C	Max. +125°C	Units	Conditions	
								VDD	Note
D207	IPD_CMP	Comparator	—	25	38	40	µA	3.0V	
D207	IPD_CMP	Comparator	—	<b>28</b>	40	50	µA	3.0V	

## 15. Module: Electrical Specifications

The typical value for the specification AD22 in Table 37-13: Analog-to-Digital Converter (ADC) Conversion Timing Specifications is incorrect. The correct value is 11+3TCY, as shown below in bold.

TABLE 37-13: ANALOG-TO-DIGITAL CONVERTER (ADC) CONVERSION TIMING SPECIFICATIONS

Standard Operating Conditions (unless otherwise stated)							
Param. No.	Sym.	Characteristic	Min.	Typ†	Max.	Units	Conditions
AD22	TCNV	Conversion Time	—	<b>11+3TCY</b>	—	TAD	Set of GO/DONE bit to Clear of GO/DONE bit

## APPENDIX A: DOCUMENT REVISION HISTORY

### Rev A Document (5/2016)

Initial release of this document.

### Rev B Document (9/2016)

Modifications brought to [Table 2](#).

#### **Silicon Errata Issues:**

Added ADC Conversion feature to [Analog-to-Digital Converter with Computation \(ADC2\)](#);

Added [EEPROM](#) and [ECCP](#) modules.

#### **Data Sheet Clarifications:**

Added modules 4 to 15.

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

*Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*

**QUALITY MANAGEMENT SYSTEM  
CERTIFIED BY DNV  
= ISO/TS 16949 =**

### Trademarks

The Microchip name and logo, the Microchip logo, AnyRate, dsPIC, FlashFlex, flexPWR, Heldo, JukeBlox, KeeLoq, KeeLoq logo, Klear, LANCheck, LINK MD, MediaLB, MOST, MOST logo, MPLAB, OptoLyzer, PIC, PICSTART, PIC32 logo, RightTouch, SpyNIC, SST, SST Logo, SuperFlash and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, ETHERSYNCH, Hyper Speed Control, HyperLight Load, IntellIMOS, mTouch, Precision Edge, and QUIET-WIRE are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PureSilicon, RightTouch logo, REAL ICE, Ripple Blocker, Serial Quad I/O, SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2016, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-0950-2





# MICROCHIP

## Worldwide Sales and Service

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://www.microchip.com/support>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Austin, TX**  
Tel: 512-257-3370

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Cleveland**  
Independence, OH  
Tel: 216-447-0464  
Fax: 216-447-0643

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Novi, MI  
Tel: 248-848-4000

**Houston, TX**  
Tel: 281-894-5983

**Indianapolis**  
Noblesville, IN  
Tel: 317-773-8323  
Fax: 317-773-5453

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**New York, NY**  
Tel: 631-435-6000

**San Jose, CA**  
Tel: 408-735-9110

**Canada - Toronto**  
Tel: 905-695-1980  
Fax: 905-695-2078

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon

**Hong Kong**  
Tel: 852-2943-5100  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8569-7000  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Chongqing**  
Tel: 86-23-8980-9588  
Fax: 86-23-8980-9500

**China - Dongguan**  
Tel: 86-769-8702-9880

**China - Guangzhou**  
Tel: 86-20-8755-8029

**China - Hangzhou**  
Tel: 86-571-8792-8115  
Fax: 86-571-8792-8116

**China - Hong Kong SAR**  
Tel: 852-2943-5100  
Fax: 852-2401-3431

**China - Nanjing**  
Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8864-2200  
Fax: 86-755-8203-1760

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xian**  
Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

### ASIA/PACIFIC

**China - Xiamen**  
Tel: 86-592-2388138  
Fax: 86-592-2388130

**China - Zhuhai**  
Tel: 86-756-3210040  
Fax: 86-756-3210049

**India - Bangalore**  
Tel: 91-80-3090-4444  
Fax: 91-80-3090-4123

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-3019-1500

**Japan - Osaka**  
Tel: 81-6-6152-7160  
Fax: 81-6-6152-9310

**Japan - Tokyo**  
Tel: 81-3-6880-3770  
Fax: 81-3-6880-3771

**Korea - Daegu**  
Tel: 82-53-744-4301  
Fax: 82-53-744-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Kuala Lumpur**  
Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

**Malaysia - Penang**  
Tel: 60-4-227-8870  
Fax: 60-4-227-4068

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-5778-366  
Fax: 886-3-5770-955

**Taiwan - Kaohsiung**  
Tel: 886-7-213-7828

**Taiwan - Taipei**  
Tel: 886-2-2508-8600  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Dusseldorf**  
Tel: 49-2129-3766400

**Germany - Karlsruhe**  
Tel: 49-721-625370

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Italy - Venice**  
Tel: 39-049-7625286

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Poland - Warsaw**  
Tel: 48-22-3325737

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**Sweden - Stockholm**  
Tel: 46-8-5090-4654

**UK - Wokingham**  
Tel: 44-118-921-5800  
Fax: 44-118-921-5820

06/23/16